

**BULLETIN PA010-12**


**PART NUMBER:**  
 38332

**MAKE:**  
 Honda

**MODEL:**  
 Accord  
 Odyssey  
 Pilot  
 Ridgeline

**YEAR:**  
 2003-2007

**ENGINE:**  
 3.0L  
 3.5L

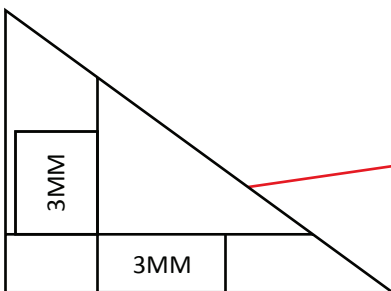

This area will need to have 3mm of material removed.

**ACCESSORY BELT DRIVE SYSTEM  
 HONDA**

Particular V-6 applications described in Honda Bulletin 08-082 may require a small modification to the front timing cover during replacement of the accessory drive belt tensioner. (NAPA part number 38332 ) The OE now provides an updated tensioner assembly which may cause interference with the front timing cover of some applications. NAPA Belts/Hoses also offers the same, updated design as the OES. The small task is to remove approximately 3mm of plastic material from the front cover, allowing proper clearance.



**IMPROPER INSTALLATION MAY RESULT IN A DAMAGED FRONT TIMING BELT COVER AND IMPROPER ACCESSORY BELT TRACKING, EVENTUALLY LEADING TO BELT FAILURE!**